

## CHANGE INFORMATION

◎The Op Amp (M5218L : IC21) has been covered with a shield sheet.

EFF. SNo. : ZA31200 - UP

Reason : To prevent the Op Amp (M5218L : IC21) from picking up digital noise inside the computer.

◎Change of capacitor (C66)

Change parts : ceramic capacitor (470pF/50V<sub>k</sub>) (Fig.1) → ceramic capacitor (ECBT1H471KB5) (Fig.2)



Fig.1



SNo. ZA84200-UP

 


Fig.2

EFF. SNo. : ZA84200 - UP

Reason : To improve the S/N ratio.

## APPENDIX

### ◎Cautionary points on repairing

If there is any noise in the LAPC-I right channel of circuit boards earlier than SNo. ZA84200, check the following as possible causes.

Note : This is only applicable when the shape of the ceramic capacitor (C66) is as shown in Fig.1.

**Factor** : ceramic capacitor (C66) has been bent toward the transistor (Q2) side.

**Reason** : if the capacitor is indeed bent as described above, it will pick up digital noise.

**Method of repair** : bent the capacitor toward IC29 (5218P) and secure it with bond or change to ceramic capacitor (ECBT1H471KB5).